

634-011

Dart Aerospace Ltd.

Date: Thursday, 06/11/2008 2:22:50 PM
 User: Julie Dawson

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	SKID TUBE ASSEMBLY
Job Number :	43240A		
Estimate Number :	10023		
P.O. Number :		Part Number :	D205634041
This Issue :	06/11/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D2580 REV D
First Issue :	1/1	Project Number :	N/A
Previous Run :	43239A	Drawing Revision :	D
	Type :	Material :	
	SKIDTUBES	Due Date :	19/11/2008
Written By :		Qty:	1
Checked & Approved By :	JLD 28.11.06	Um:	Each
Comment :	Est Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ Est Rev: O 06.02.28 Added paperwork EC Est Rev:P 07-07-09 SS Wearplates & Gaskets JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------

**Comment:** DOCUMENT CONTROL

Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG002

N/A

2.0	D25001190	Ext'n -I' Beam Tube 4"
-----	-----------	------------------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	B-40150

ALM 8-11-05

(ix)

3.0	D2596	Web, 205 Skidtube
-----	-------	-------------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2596	205 Web	B-43874

ALM 8-11-05

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------

**Comment:** LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Debur ends

3-Acid etch and Alodine tube per QSI 005 4.1

ALM 8-11-05

Date: Thursday, 06/11/2008 2:22:50 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43240A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

5.0 QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

CD 8-11-7

6.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

3-Countersink holes as per Dwg D2580without cutting fluid

4-Deburr and blow out all chips from inside of tube

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 109449

Sikaflex expire date: 8-12-1

Start Time: 10:45 Date: 8-11-7

Fin Time: 2:30 Date: 8-11-11

ALM 8-11-07

SL 8-11-7

7.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

DP 8-11-11

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

ALM 8-11-12

Date: Thursday, 06/11/2008 2:22:50 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43240A

Part Number: D205634041

Job Number:



Seq. #: Machine Or Operation: Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 08/11/12

10.0

D25763

Step (maching detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2576-3	Step	232392

BE 08-11-13

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
20	D2579	Spacers	B-41666

AWM 8-11-12

20 PCS

12.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R Aluminum Rod

m109813

BE 8-11-13

PD 7

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R Aluminum Rod

m109813

BE 8-11-13

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Debur holes

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

AWM 8-11-18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D205-634-041 PAR #: _____ Fault Category: _____ NCR: Yes (No) DQA: 11 Date: 08.11.28

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR: <u>43240A</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
8/11/20	#103	one pin hole found during inspection on the 4th saddle hole from the row line (FWD)	<u>10/5/11/22</u>	<ul style="list-style-type: none"> - Not contamination in the weld. Just a tiny pin hole. - Buff off pin hole. - All is good, no more void. 	<u>11</u> <u>8-11-20</u>	<u>10/8/11-20</u>	<u>10/5/11/22</u>	<u>8/11/20</u>
		P.C. contamination during welding			<u>11</u> <u>8-11-20</u>			<u>8/11/20</u>

NOTE: Date & initial all entries

Date: Thursday, 06/11/2008 2:22:50 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43240A

Part Number: D205634041

Job Number:



Seq. #: Machine Or Operation: Description :

13.0 QC10 VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 08/11/20 (XU)

14.0 QC5 INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/11/20 (XU)

15.0 HAND FINISHING1 HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FL 08/11/21 (C)

16.0 POWDER COATING POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

10:30
320°F
11:00

M-1 08/11/21

17.0 QC3 INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-11-25 (XU)

18.0 D2855 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap

Batch:

B42343

JP

19.0 AN35A Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch:

M100188

JP

08-11-25 (XU)

Date: Thursday, 06/11/2008 2:22:50 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43240A

Part Number: D205634041

Job Number:



Seq. #: Machine Or Operation: Description :

20.0 AN960JD10L Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M1105793

JL

21.0 ALS71032130 Insert



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

Insert

Batch: M1105819

X

JL

22.0 AN3C4A BOLT



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

BOLT

Batch: M1109798

JL

23.0 AN960C10L washer



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

washer

Batch: M1109798

JL

24.0 D356613 Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B342147

JL

25.0 D35665 Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B3411467

JL

26.0 D35661 Gasket



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

GASKET

Batch: B343264

JL

06-11-25

(X1)

Date: Thursday, 06/11/2008 2:22:50 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43240A

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

27.0	D356413	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1341933

JH

28.0	D356411	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1343192

JH

29.0	D35649	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1342258

JH

30.0	D35645	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1342236

JH

31.0	D25943	O-Ring, 205 Skidtube
------	--------	----------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: 1329908

JH

32.0	D25941	Plug, 205 Skidtube
------	--------	--------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: 1341434

JH

33.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

✓ 1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

M109449

JH

06-11-25

(Signature)

Date: Thursday, 06/11/2008 2:22:50 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43240A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

2 Sikaflex expire date: 08/11

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 14104499
Sikaflex expire date: 08/11

HL
08-11-25 (X)

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: m109449

FX 08/11/25 (1)

34.0

QC5

INSPECT WORK TO CURRENT STEP



Sos 11/26/08



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



SP

Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location: _____

PPP Rev: _____

PPP 43240

Sos 08/11/27 (X)

36.0

QC21

FINAL INSPECTION/W/O RELEASE



08/11/28 (X)

Comment: FINAL INSPECTION/W/O RELEASE

MF 08-11-27

Job Completion



DART

DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07-06-28 *[Signature]*

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 43240A

Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

RELEASED
07.06.28

Diagram illustrating the grinding locations for the D2576-3 step. The diagram shows a cross-section of the step with the following labels:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- LOCATION RIDGE ON UNDERSIDE OF D2576
- $\frac{1}{16}$

Diagram illustrating the assembly of a bolted joint. The components and their quantities are:

- DRILL PRIOR TO D2855 CAP INSTALLATION (2 PLACES)
- SEAL WITH SIKAFLEX-241/-291
- AN3-SA BOLT (1)
- AN960J10L WASHER (1) (2 PLACES)
- D2855 CAP

The diagram shows a circular cross-section of a component with a central hole. A bolt is shown passing through the hole, secured by a washer and a cap. The cap is labeled D2855. The bolt is labeled AN3-SA BOLT (1). The washer is labeled AN960J10L WASHER (1) (2 PLACES). The cap is labeled D2855 CAP. The bolt is shown passing through the hole, secured by a washer and a cap. The cap is labeled D2855. The bolt is labeled AN3-SA BOLT (1). The washer is labeled AN960J10L WASHER (1) (2 PLACES). The bolt is shown passing through the hole, secured by a washer and a cap. The cap is labeled D2855. The bolt is labeled AN3-SA BOLT (1). The washer is labeled AN960J10L WASHER (1) (2 PLACES).

D2579 SPACER

WEB (REF)

130 (REF)
0 PLACES

AFTER PERFORATION

1. CHA
2. INS
3. WEL
4. C'B

**AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:**

- 1. CHAMFER HOLE 0.050 X 45°**
- 2. INSERT D2579 SPACER (20 PLACES)**
- 3. WELD INTO PLACE AND GRIND FLUSH**
- 4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP**

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

37.50
DISTANCE TO AFT END
OF D2596 WEB
3 7
1.750 1.750
#0.508 (TYP.)
(40 PLACES)
REFER TO DETAIL A
REFER TO DETAIL A
8.750
17.375
26.000
34.188
57.313 (REF)
7 EQUAL SPACES
8.188 PITCH
38.0
91.500
190.0
(D2500-1)

[illegible]

0.5

1.5

1.5

D

P

P

P

P

P

P

P

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

WELD AS PER DETAIL B

8

1.5

1.5

1.5

REFER TO DETAIL C

D3566-1

D3566-5

D3566-1

D3566-13

D3564-11

 
D3564-5

D3564-9

D3564-13

AN304A BOLT (1)
AN960C10L WASHER (1)
(50 PLACES)

DESIGN J DRAWN BY

COPYRIGHT © 1996 BY DART AEROSPACE LTD. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	DESIGN	DRAWN BY	 DART AEROSPACE LTD. <small>MARKHAM, ONTARIO, CANADA</small>	
	CHECKED	APPROVED	DRAWING NO.	REV. D
	DATE	TITLE	SHEET 2 OF 3	
	07.02.27	205 SKIDTUBE ASSEMBLY		SCALE 1:24

RELEASED
07 Dec 28

Diagram illustrating the grinding locations on the underside of the propeller:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- LOCATION RIDGE ON UNDERSIDE OF D2576
- GRIND FLUSH

Diagram illustrating the rear view of the engine cover assembly. The diagram shows the installation of the AN960JD10L washer and the D2855 cap. The washer is secured with an AN3-SA bolt. The cap is secured with a D2855 cap. The sealant is applied to the rear of the cap. The diagram includes the following labels:

- AN3-SA BOLT (1)
- AN960JD10L WASHER (1)
- D2855 CAP
- SEAL WITH SIKAFLEX-241/-291
- SEE NOTE ii)

D2579 SPACER
 D2596 WEB (REF)
 7-1032-130 (REF)
 (TYP 50 PLACES)

AFTER PERFORM
 1. CHA
 2. INS
 3. WEL
 4. C'B

**AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:**

- 1. CHAMFER HOLE 0.050 X 45°**
- 2. INSERT D2579 SPACER (20 PLACES)**
- 3. WELD INTO PLACE AND GRIND FLUSH**
- 4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP**

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

[illegible]

(MAKE FROM D2580-1 DRILLING DETAIL)

Technical drawing of a horizontal curve showing dimensions and callouts. The drawing includes the following dimensions and features:

- Overall length: 51.340
- Distance from start to first hole: 5.985
- Distance between first and second hole: 5.338 (REF)
- Distance from second hole to third hole: 3.630 (REF)
- Distance between third and fourth hole: 39.580
- Distance from fourth hole to end: 5.915
- Hole diameter: $\phi 0.508$ (8 PLACES)
- Radius of curve: $\phi 0.640$
- Angle of curve: 20.0
- Distance between hole and tangent point: 1.0
- Distance from start to tangent point: 13.4
- Distance from tangent point to end: 32.0 \pm 1.0
- Callout 4: Located at the start and end of the curve.

WELD AS PER DETAIL F

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

NO C'BORE NO PLUG

NO C'BORE NO PLUG

NO C'BORE NO PLUG

D3566-1

D3566-5

D3566-1

D3566-13

D3564-11

D3564-5

D3564-9

D3564-13

AN3C4A BOLT (1)

AN960C10L WASHER (1)

(50 PLACES)

DESIGN	DRAWN BY
--------	----------

COPYRIGHT © 1996 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN

CHECKED *ld*

DATE _____

07.02.27

DRAWN BY

APPROVED

DART

DART AEROSPACE LTD.
HAWKESBURY, ONTARIO, CANADA

DRAWING NO.

02580

205 SKIDTUBE ASSEMBLY

REV. 0

SHEET 3 OF 3

1:24

NO. 173

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliott
Job number: 41315A0
Part number: D204 635041
Description: 204/205 skid tube
Welding Process: Tig[☒] Mig[]
Base material: Aluminium
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]

UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]

Qualifier Pat Duval Date of Test Coupon 08-09-24
Welder Barclay Elliott Date of Test Coupon 08-09-24

The above named individual is qualified in accordance with AWS D17.1.2001 to weld